

感应减速电机
INDUCTION GEAR MOTOR

40W
90mm



电机型号/性能 List of motor characteristics

电机型号 Motor Model		输出功率 Output Power	电压 Voltage	频率 Frequenc	电流 Current	额定转速 Rated Speed	额定转矩 Rated Torque	启动转矩 Starting Torque	运行电容 Capacitor
齿轮轴型 Pinion Shaft	圆轴型 Round Shaft	W	V	Hz	A	r/min	mN.m	mN.m	μF/VAC
5IK40GN-C	5IK40A-C	40	1ph220	50	0.35	1350	294	194	2.5/450
				60	0.35	1550	232	199	
5IK40GN-A	5IK40A-A	40	1ph110	50	0.64	1350	286	226	10.0/250
				60	0.66	1550	234	231	
5IK40GN-S	5IK40A-S	40	3ph220	50	0.32	1350	284	1130	/
				60	0.28	1550	241	846	
5IK40GN-S3	5IK40A-S3	40	3ph380	50	0.18	1350	284	1086	/
				60	0.16	1550	241	837	

- 各种安全规格以电机铭牌上的型号名取得认证。
- 注：“A”型号中电压为 110V 时，配置电容器容量以实际铭牌为准。
- When the motor is approved under various safety standards, the model name on the nameplate is the approved model name.
- Note “sAIt means the voltage 110v. the assembly capacitor vaule it is according the labe.

减速箱减速比/性能对照表 Gear reduction ratio/performance comparison

减速比 Gear Ratio		3	3.6	5	6	7.5	9	10	12.5	15	18	20	25	30	36	40	50	60	75	90	100	120	150	180	200
50Hz	转速 Speed r/min	450	375	270	225	180	150	135	108	90	75	67.5	54	45	37.5	33.7	27	22.5	18	15	13.5	11	9	7.5	6.75
	转矩 Torque N.m	0.71	0.86	1.19	1.43	1.79	2.14	2.38	2.98	3.57	3.86	4.29	5.36	6.43	7.72	7.72	9.64	10	10	10	10	10	10	10	10
60Hz	转速 Speed r/min	516	430	310	258	206	172	155	124	103	86	77.5	62	51.6	43	38.75	31	25.8	20.6	17.2	15.5	12.9	10.3	8.6	7.75
	转矩 Torque N.m	0.56	0.68	0.94	1.13	1.41	1.69	1.88	2.35	2.82	3.04	3.38	4.23	5.07	6.09	6.09	7.61	9.13	10	10	10	10	10	10	10


- 表中转速是以电机的平均转速为基数除以减速比而算出的数值。实际转速将随负载大小而变化，变化范围 2~20%。
- 表中 色框表示输出轴的旋转方向与电机旋转方向相反。
- 表中转矩是以电机额定转矩 × 减速比 × 传动效率计算而得。
- 减速箱的最大容许转矩为 10N·M。
- In the table, the speed is calculated from the base of the motor's average speed divided by the deceleration ratio.The actual speed will vary with the load, ranging from 2 % to 20%.
- The box in the table indicates that the rotation direction of the output axis is opposite to that of the motor.
- Table transfer torque is calculated from motor rated torque * deceleration ratio * transmission efficiency.
- The maximum allowable torque of the decelerator is 10N·M.

STEPPERONLINE®

外形尺寸（单位mm）Dimension (unit mm)


圆轴电机

重量 Weight: 2.4kg

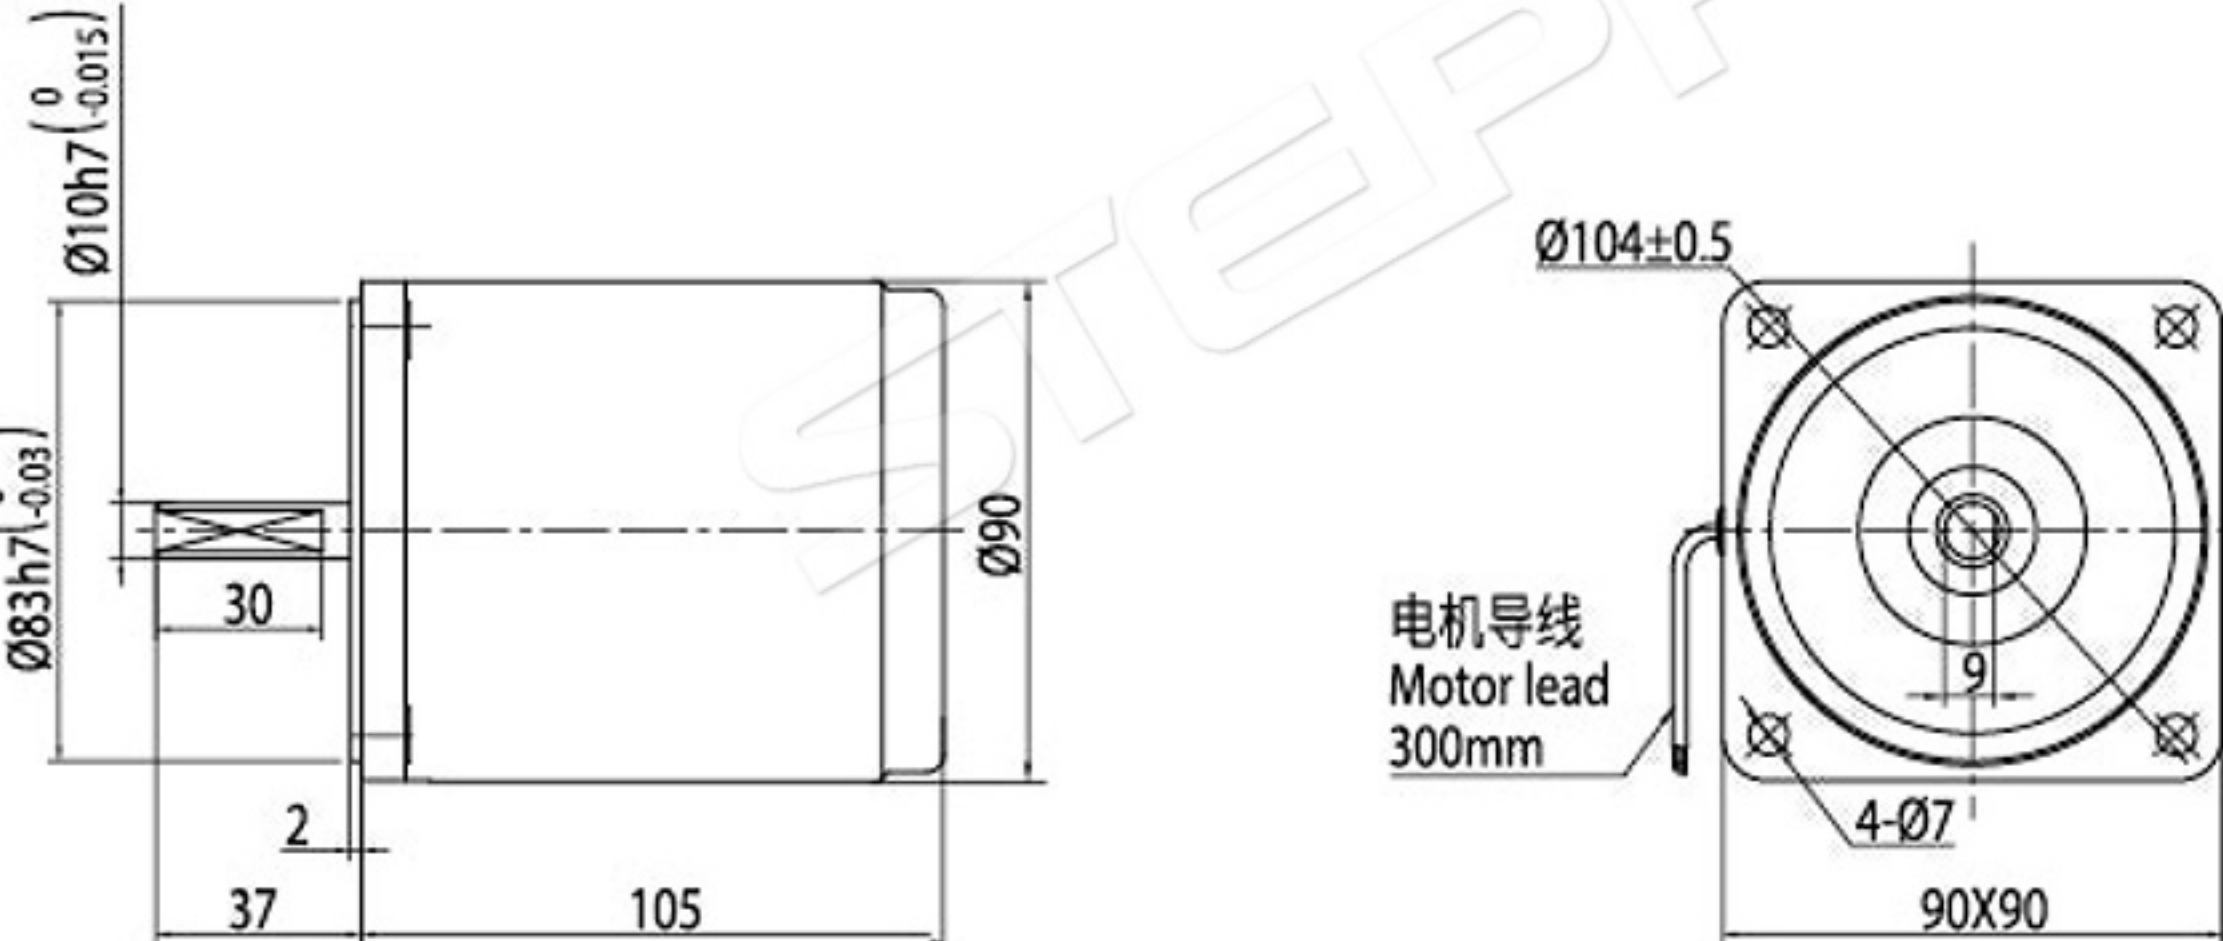


组合：接线盒（可选，详见 P150）型电机 + 标准减速箱（减速比 1:3~200）

重量 Weight: 3.9kg

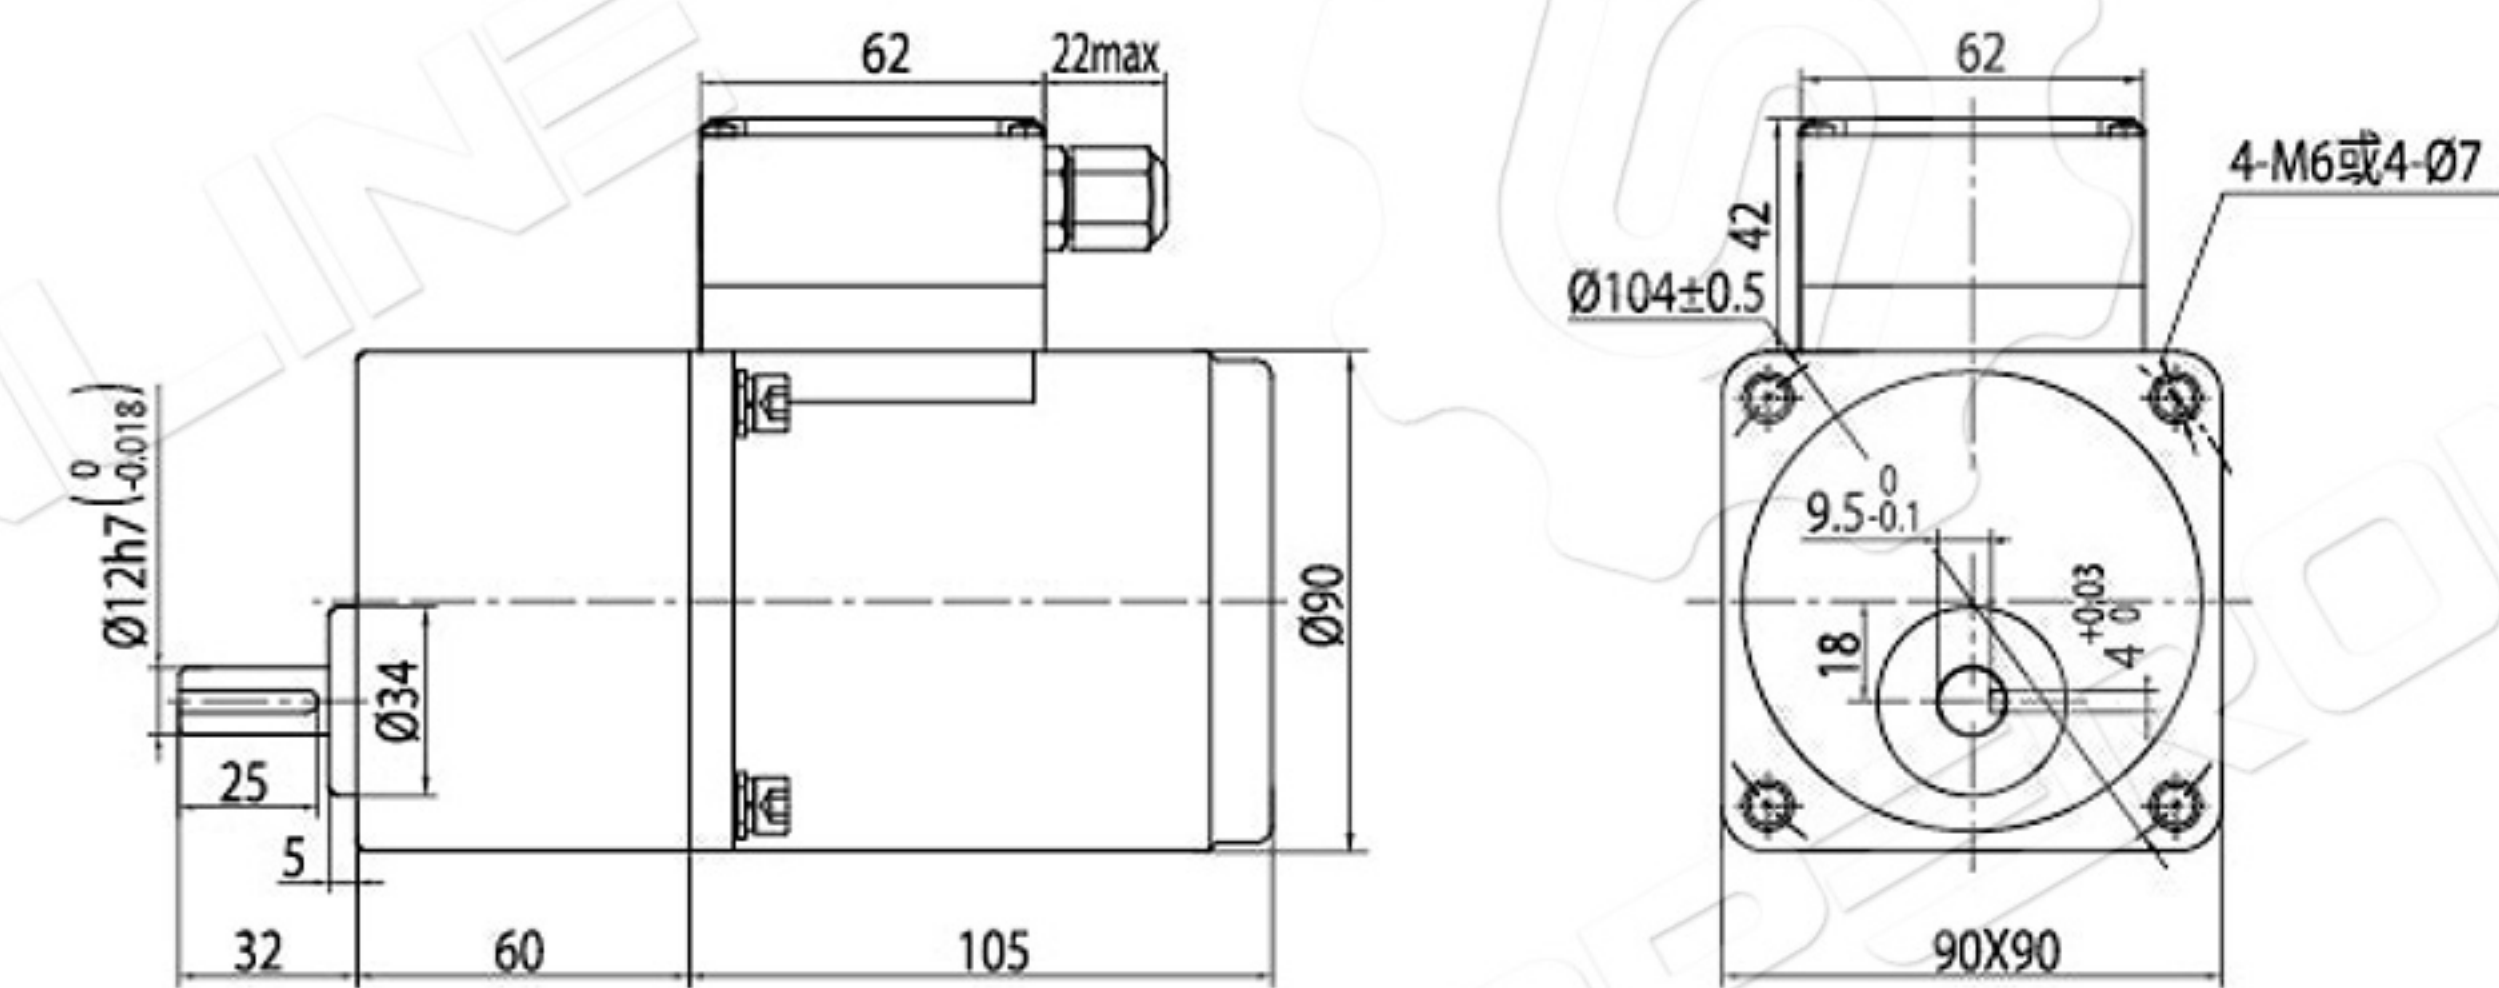

键（减速器附件）

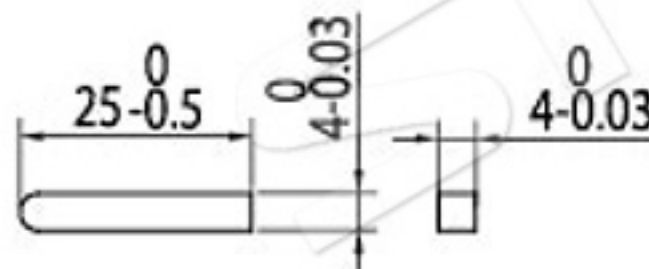


短箱体 Short Gear Box

●其中速比 3~20 可以做成短型减速箱，高度为 42mm。Gear ratio 3~20, short case is possible, Height of 42 mm.

接线图 Wiring Diagram

- 运转方向指从电机轴看来的方向。CW 表示顺时针方向，CCW 表示逆时针方向。
- 表中所记型号为齿轮轴型，圆轴型亦同。
- The direction of motor rotation is as viewed from the shaft end of motoc CW represents the clockwise direction, while CCW represents the counterdockwise direction.
- Name indicated in the list is pinion shaft we, also valid for the equivalent round shaft type.

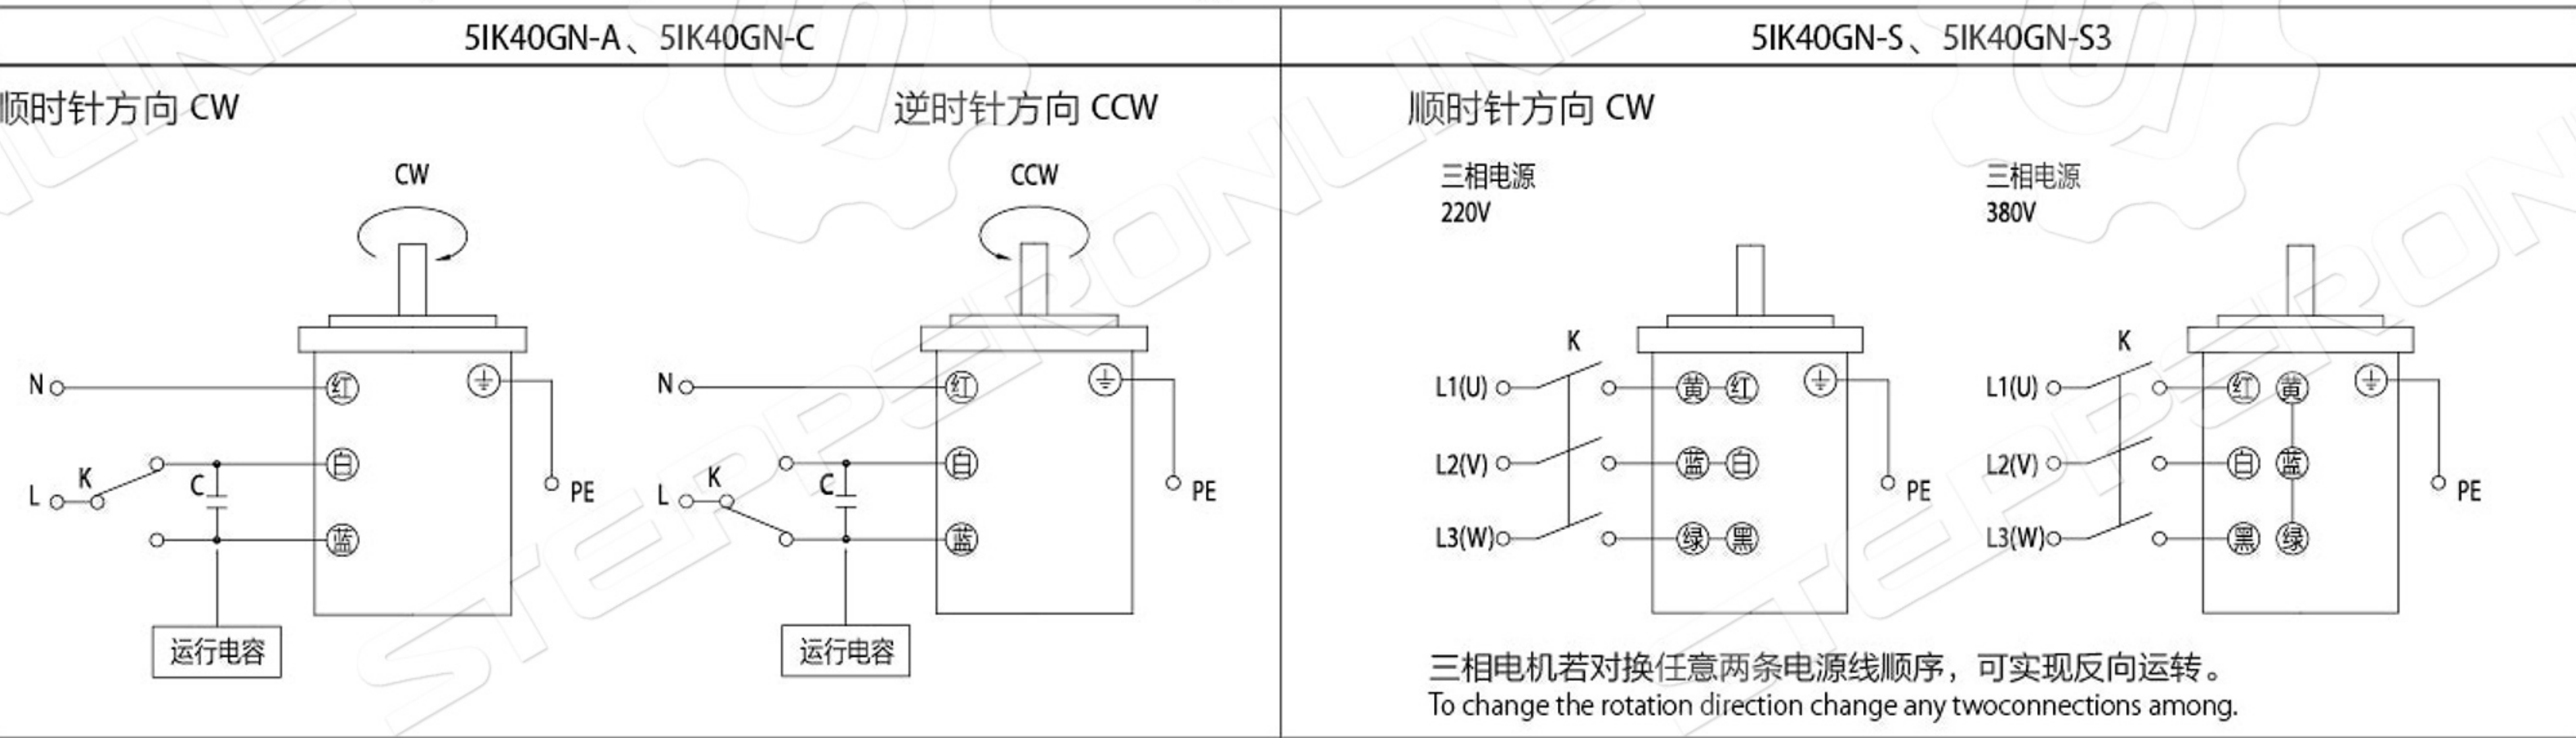

请注意 Note

单相电机运转方向的转换应在电机停止后进行。
若在电机运转时转换运转方向，可能发生无法转换运转方向或须费时较久的情况。
Change the direction of single-phase motor rotation only after bring the motor to a stop.
If an attempt is made to change the direction of rotation while the motor is rotating, motor may ignore reversing command or change its direction of rotation after some delay.